SAFETY DATA SHEET

B62L260

Section 1. Identification : SHERPLATE PW Epoxy (Part A) **Product name** Blue **Product code** : B62L260 Other means of : Not available. identification **Product type** : Liquid. Relevant identified uses of the substance or mixture and uses advised against Paint or paint related material. : THE SHERWIN-WILLIAMS COMPANY Manufacturer 101 W. Prospect Avenue Cleveland, OH 44115 **Emergency telephone** : US / Canada: (800) 424-9300 number of the company Mexico: SETIQ 800-00-214-00 / 55-5559-1588 Available 24 hours and 365 days a year **Product Information** : US / Canada: (800) 524-5979 Mexico: Not Available **Telephone Number** : US / Canada: (800) 424-9300 Transportation Emergency Mexico: SETIQ 800-00-214-00 / 55-5559-1588 Available 24 hours and 365 days a year **Telephone Number**

Section 2. Hazards identification

OSHA/HCS status	: This material is considered hazardous by the OSHA Hazard Communication Standard (29 CFR 1910.1200).
Classification of the substance or mixture	: SKIN CORROSION/IRRITATION - Category 1A SERIOUS EYE DAMAGE/ EYE IRRITATION - Category 1 SKIN SENSITIZATION - Category 1 CARCINOGENICITY - Category 2 SPECIFIC TARGET ORGAN TOXICITY (REPEATED EXPOSURE) - Category 2
	Percentage of the mixture consisting of ingredient(s) of unknown acute inhalation toxicity: 22.1%
GHS label elements	
Hazard pictograms	
Signal word	: Danger
Hazard statements	: Causes severe skin burns and eye damage. May cause an allergic skin reaction. Suspected of causing cancer. May cause damage to organs through prolonged or repeated exposure.
Precautionary statements	

Date of issue/Date	of revision	: 4/19/2024	Date of previous issue	: 1/23/2024	Version :	23.03	1/13
B62L260	SHERPLATE PW Epo	xy (Part A)			SHW-85-N	A-GHS-US	
	Blue						

Section 2. Hazards identification

Prevention	: Obtain special instructions before use. Do not handle until all safety precautions have been read and understood. Wear protective gloves, protective clothing and eye or face protection. Do not breathe vapor. Wash thoroughly after handling. Contaminated work clothing must not be allowed out of the workplace.
Response	: IF exposed or concerned: Get medical advice or attention. IF INHALED: Remove person to fresh air and keep comfortable for breathing. Immediately call a POISON CENTER or doctor. IF SWALLOWED: Immediately call a POISON CENTER or doctor. Rinse mouth. Do NOT induce vomiting. IF ON SKIN (or hair): Take off immediately all contaminated clothing. Rinse skin with water. Immediately call a POISON CENTER or doctor. Wash contaminated clothing before reuse. IF ON SKIN: Wash with plenty of water. If skin irritation or rash occurs: Get medical advice or attention. IF IN EYES: Rinse cautiously with water for several minutes. Remove contact lenses, if present and easy to do. Continue rinsing. Immediately call a POISON CENTER or doctor.
Storage	: Store locked up.
Disposal	 Dispose of contents and container in accordance with all local, regional, national and international regulations.
Supplemental label elements	WARNING: This product contains chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. FOR INDUSTRIAL USE ONLY. This product must be mixed with other components before use. Before opening the packages, READ AND FOLLOW WARNING LABELS ON ALL COMPONENTS.
	Please refer to the SDS for additional information. Keep out of reach of children. Do not transfer contents to other containers for storage.
Hazards not otherwise classified	: None known.

Section 3. Composition/information on ingredients

Substance/mixture	: Mixture
Other means of	: Not available.
identification	

CAS number/other identifiers

Ingredient name	% by weight	CAS number
Styrenated-Phenolic Resin	≥10 - ≤25	61788-44-1
Phenylmethanol	≤10	100-51-6
Titanium Dioxide	≤10	13463-67-7
1,3-Benzenedimethanamine	≤10	1477-55-0
Cyclohexanedimethanamine	≤8.8	2579-20-6

Any concentration shown as a range is to protect confidentiality or is due to batch variation.

There are no additional ingredients present which, within the current knowledge of the supplier and in the concentrations applicable, are classified and hence require reporting in this section.

Occupational exposure limits, if available, are listed in Section 8.

Section 4. First aid measures

Description of	i necessary	first aid measures

Eye contact

: Get medical attention immediately. Call a poison center or physician. Immediately flush eyes with plenty of water, occasionally lifting the upper and lower eyelids. Check for and remove any contact lenses. Continue to rinse for at least 10 minutes. Chemical burns must be treated promptly by a physician.

Date of issue/Date	of revision	: 4/19/2024	Date of previous issue
B62L260	SHERPLATE PW Epo	xy (Part A)	
	Blue		

Section 4. First aid measures

Inhalation	: Get medical attention immediately. Call a poison center or physician. Remove victim to fresh air and keep at rest in a position comfortable for breathing. If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. If not breathing, if breathing is irregular or if respiratory arrest occurs, provide artificial respiration or oxygen by trained personnel. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband. In case of inhalation of decomposition products in a fire, symptoms may be delayed. The exposed person may need to be kept under medical surveillance for 48 hours.
Skin contact	: Get medical attention immediately. Call a poison center or physician. Wash with plenty of soap and water. Remove contaminated clothing and shoes. Wash contaminated clothing thoroughly with water before removing it, or wear gloves. Continue to rinse for at least 10 minutes. Chemical burns must be treated promptly by a physician. In the event of any complaints or symptoms, avoid further exposure. Wash clothing before reuse. Clean shoes thoroughly before reuse.
Ingestion	: Get medical attention immediately. Call a poison center or physician. Wash out mouth with water. Remove dentures if any. If material has been swallowed and the exposed person is conscious, give small quantities of water to drink. Stop if the exposed person feels sick as vomiting may be dangerous. Do not induce vomiting unless directed to do so by medical personnel. If vomiting occurs, the head should be kept low so that vomit does not enter the lungs. Chemical burns must be treated promptly by a physician. Never give anything by mouth to an unconscious person. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband.

Most important symptoms/effects, acute and delayed

Blue

Potential acute health effe	
Eye contact	: Causes serious eye damage.
Inhalation	: No known significant effects or critical hazards.
Skin contact	: Causes severe burns. May cause an allergic skin reaction.
Ingestion	: No known significant effects or critical hazards.
<u>Over-exposure signs/sym</u>	<u>itoms</u>
Eye contact	: Adverse symptoms may include the following: pain watering redness
Inhalation	: No specific data.
Skin contact	: Adverse symptoms may include the following: pain or irritation redness blistering may occur
Ingestion	: Adverse symptoms may include the following: stomach pains
Indication of immediate me	lical attention and special treatment needed, if necessary
Notes to physician	 In case of inhalation of decomposition products in a fire, symptoms may be delayed. The exposed person may need to be kept under medical surveillance for 48 hours.
Specific treatments	: No specific treatment.
Protection of first-aiders	: No action shall be taken involving any personal risk or without suitable training. If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. Wash contaminated clothing thoroughly with water before removing it, or wear gloves.
Date of issue/Date of revision	: 4/19/2024 Date of previous issue : 1/23/2024 Version : 23.03 3/13
B62L260 SHERPLATE P	V Epoxy (Part A) SHW-85-NA-GHS-US

3/13

Section 4. First aid measures

See toxicological information (Section 11)

Section 5. Fire-fighting measures

Extinguishing media	
Suitable extinguishing media	: Use an extinguishing agent suitable for the surrounding fire.
Unsuitable extinguishing media	: None known.
Specific hazards arising from the chemical	: In a fire or if heated, a pressure increase will occur and the container may burst.
Hazardous thermal decomposition products	: Decomposition products may include the following materials: carbon dioxide carbon monoxide nitrogen oxides metal oxide/oxides
Special protective actions for fire-fighters	 Promptly isolate the scene by removing all persons from the vicinity of the incident if there is a fire. No action shall be taken involving any personal risk or without suitable training.
Special protective equipment for fire-fighters	: Fire-fighters should wear appropriate protective equipment and self-contained breathing apparatus (SCBA) with a full face-piece operated in positive pressure mode.

Section 6. Accidental release measures

Personal precautions, protective equipment and emergency procedures

For non-emergency personnel	:	No action shall be taken involving any personal risk or without suitable training. Evacuate surrounding areas. Keep unnecessary and unprotected personnel from entering. Do not touch or walk through spilled material. Do not breathe vapor or mist. Provide adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Put on appropriate personal protective equipment.
For emergency responders	:	If specialized clothing is required to deal with the spillage, take note of any information in Section 8 on suitable and unsuitable materials. See also the information in "For non-emergency personnel".
Environmental precautions	:	Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers. Inform the relevant authorities if the product has caused environmental pollution (sewers, waterways, soil or air).
Methods and materials for co	nt	ainment and cleaning up
Small spill	:	Stop leak if without risk. Move containers from spill area. Dilute with water and mop up if water-soluble. Alternatively, or if water-insoluble, absorb with an inert dry material and place in an appropriate waste disposal container. Dispose of via a licensed waste disposal contractor.
Large spill	:	Stop leak if without risk. Move containers from spill area. Approach release from upwind. Prevent entry into sewers, water courses, basements or confined areas. Wash spillages into an effluent treatment plant or proceed as follows. Contain and collect spillage with non-combustible, absorbent material e.g. sand, earth, vermiculite or diatomaceous earth and place in container for disposal according to local regulations (see Section 13). Dispose of via a licensed waste disposal contractor. Contaminated absorbent material may pose the same hazard as the spilled product. Note: see Section 1 for emergency contact information and Section 13 for waste disposal.

Date of issue/Date	of revision	: 4/19/2024	Date of previous issue	: 1/23/2024	Version : 23.03	4/13
B62L260	SHERPLATE PW Epo: Blue	xy (Part A)			SHW-85-NA-GHS	S-US

Section 7. Handling and storage

Precautions for safe handling	1	
Protective measures	:	Put on appropriate personal protective equipment (see Section 8). Persons with a history of skin sensitization problems should not be employed in any process in which this product is used. Avoid exposure - obtain special instructions before use. Do not handle until all safety precautions have been read and understood. Do not get in eyes or on skin or clothing. Do not breathe vapor or mist. Do not ingest. If during normal use the material presents a respiratory hazard, use only with adequate ventilation or wear appropriate respirator. Keep in the original container or an approved alternative made from a compatible material, kept tightly closed when not in use. Empty containers retain product residue and can be hazardous. Do not reuse container.
Advice on general occupational hygiene	:	Eating, drinking and smoking should be prohibited in areas where this material is handled, stored and processed. Workers should wash hands and face before eating, drinking and smoking. Remove contaminated clothing and protective equipment before entering eating areas. See also Section 8 for additional information on hygiene measures.
Conditions for safe storage, including any incompatibilities	:	Store in accordance with local regulations. Store in original container protected from direct sunlight in a dry, cool and well-ventilated area, away from incompatible materials (see Section 10) and food and drink. Store locked up. Keep container tightly closed and sealed until ready for use. Containers that have been opened must be carefully resealed and kept upright to prevent leakage. Do not store in unlabeled containers. Use appropriate containment to avoid environmental contamination. See Section 10 for incompatible materials before handling or use.

Section 8. Exposure controls/personal protection

Control parameters

Occupational exposure limits (OSHA United States)

Ingredient name	CAS #	Exposure limits
Styrenated-Phenolic Resin	61788-44-1	None.
Phenylmethanol	100-51-6	OARS WEEL (United States, 4/2022). TWA: 10 ppm 8 hours.
Titanium Dioxide	13463-67-7	OSHA PEL (United States, 5/2018).
		TWA: 15 mg/m ³ 8 hours. Form: Total dust ACGIH TLV (United States, 1/2023). TWA: 2.5 mg/m ³ 8 hours. Form: respirable
1.2. Developedimenthemensing		fraction, finescale particles
1,3-Benzenedimethanamine	1477-55-0	ACGIH TLV (United States, 1/2023). Absorbed through skin. C: 0.018 ppm NIOSH REL (United States, 10/2020). Absorbed through skin.
		CEIL: 0.1 mg/m ³
Cyclohexanedimethanamine	2579-20-6	None.

Occupational exposure limits (Canada)

Ingredien	it name		C	AS #	Exposure limi	ts		
Benzyl ald	cohol		10	00-51-6	OARS WEEL (TWA: 10 ppm	•	4/2022).	
m-Xylylen	ediamine		14	177-55-0	CA Alberta Pro Absorbed thro C: 0.1 mg/m ³ CA British Col 6/2022). Absor C: 0.1 mg/m ³	ovincial (Cana ough skin. lumbia Provinc	cial (Cana	
Date of issue/	Date of revision	: 4/19/2024	Date of previou	us issue	: 1/23/2024	Version	: 23.03	5/13
62L260	SHERPLATE PW Blue	Epoxy (Part A)				SHW-85	-NA-GHS-U	S

Section 8. Exposure controls/personal protection

	CA Ontario Provincial (Canada, 6/2019). Absorbed through skin. Ceiling Limit: 0.1 mg/m ³ CA Quebec Provincial (Canada, 6/2022). Absorbed through skin. STEV: 0.1 mg/m ³ 15 minutes. CA Saskatchewan Provincial (Canada, 7/2013). Absorbed through skin. CEIL: 0.1 mg/m ³
--	---

Occupational exposure limits (Mexico)

	CAS #	Exposure limits
1,3-Benzenedimethanamine		NOM-010-STPS-2014 (Mexico, 4/2016). Absorbed through skin. CEIL: 0.1 mg/m ³

Biological exposure indices (United States)

No exposure indices known.

Biological exposure indices (Canada)

No exposure indices known.

Biological exposure indices (Mexico)

No exposure indices known.

Appropriate engineering controls Environmental exposure controls		If user operations generate dust, fumes, gas, vapor or mist, use process enclosures, local exhaust ventilation or other engineering controls to keep worker exposure to airborne contaminants below any recommended or statutory limits. Emissions from ventilation or work process equipment should be checked to ensure they comply with the requirements of environmental protection legislation. In some cases, fume scrubbers, filters or engineering modifications to the process equipment will be necessary to reduce emissions to acceptable levels.
Individual protection measu	<u>res</u>	
Hygiene measures	:	Wash hands, forearms and face thoroughly after handling chemical products, before eating, smoking and using the lavatory and at the end of the working period. Appropriate techniques should be used to remove potentially contaminated clothing. Contaminated work clothing should not be allowed out of the workplace. Wash contaminated clothing before reusing. Ensure that eyewash stations and safety showers are close to the workstation location.
Eye/face protection	:	Safety eyewear complying with an approved standard should be used when a risk assessment indicates this is necessary to avoid exposure to liquid splashes, mists, gases or dusts. If contact is possible, the following protection should be worn, unless the assessment indicates a higher degree of protection: chemical splash goggles and/ or face shield. If inhalation hazards exist, a full-face respirator may be required instead.
Skin protection		
Hand protection	:	Chemical-resistant, impervious gloves complying with an approved standard should be worn at all times when handling chemical products if a risk assessment indicates this is necessary. Considering the parameters specified by the glove manufacturer, check during use that the gloves are still retaining their protective properties. It should be noted that the time to breakthrough for any glove material may be different for different glove manufacturers. In the case of mixtures, consisting of several substances, the protection time of the gloves cannot be accurately estimated.

Date of issue/Date	of revision	: 4/19/2024	Date of previous issue	: 1/23/2024	Version	:23.03	6/13
B62L260	SHERPLATE PW Epox	xy (Part A)			SHW-85-	NA-GHS-US	
	Blue						

Section 8. Exposure controls/personal protection

Body protection	 Personal protective equipment for the body should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product.
Other skin protection	: Appropriate footwear and any additional skin protection measures should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product.
Respiratory protection	: Based on the hazard and potential for exposure, select a respirator that meets the appropriate standard or certification. Respirators must be used according to a respiratory protection program to ensure proper fitting, training, and other important aspects of use.

Section 9. Physical and chemical properties

The conditions of measurement of all properties are at standard temperature and pressure unless otherwise indicated.

Appearance

Physical state	: Liqu	id.
Color	: Blue	9.
Odor	: Not	available.
Odor threshold	: Not	available.
рН	: Not	applicable.
Melting point/freezing point	: Not	available.
Boiling point, initial boiling point, and boiling range	: 202	°C (395.6°F)
Flash point	: Clos	sed cup: 100°C (212°F) [Pensky-Martens Closed Cup]
Evaporation rate	: Not	available.
Flammability	: Not	available.
Lower and upper explosion limit/flammability limit		ver: 1.3% ver: 13%
Vapor pressure		2 kPa (0.15 mm Hg)
Relative vapor density		2 [Air = 1]
Relative density	: 1.66	
Solubility(ies)	:	
Media		Result

Media		Result
cold water		Not soluble
Partition coefficient: n- octanol/water	: Not	applicable.
Auto-ignition temperature	: Not	available.
Decomposition temperature	: Not	available.
Viscosity	: Kin	ematic (40°C (104°F)): >20.5 mm²/s (>20.5 cSt)
Molecular weight	: Not	applicable.
Heat of combustion	: 5.75	i5 kJ/g

Section 10. Stability and reactivity

Reactivity	: No specific test data related to reactivity available for this product or its ingredients.
Chemical stability	: The product is stable.
Possibility of hazardous reactions	: Under normal conditions of storage and use, hazardous reactions will not occur.
Conditions to avoid	: No specific data.
Incompatible materials	: No specific data.
Hazardous decomposition products	: Under normal conditions of storage and use, hazardous decomposition products should not be produced.

Section 11. Toxicological information

Information on toxicological effects

Acute toxicity

Product/ingredient name	Result	Species	Dose	Exposure
Styrenated-Phenolic Resin	LD50 Dermal	Rabbit	>5010 mg/kg	-
	LD50 Oral	Rat	2500 mg/kg	-
Phenylmethanol	LD50 Dermal	Rabbit	2000 mg/kg	-
2	LD50 Oral	Rat	1230 mg/kg	-
1,3-Benzenedimethanamine	LC50 Inhalation Gas.	Rat	700 ppm	1 hours
	LD50 Dermal	Rabbit	2 g/kg	-
	LD50 Oral	Rat	930 mg/kg	-
Cyclohexanedimethanamine	LD50 Oral	Rat	880 mg/kg	-

Irritation/Corrosion

Product/ingredient name	Result	Species	Score	Exposure	Observation
Styrenated-Phenolic Resin	Eyes - Mild irritant	Rabbit	-	0.1 MI	-
-	Skin - Mild irritant	Rabbit	-	0.5 MI	-
Phenylmethanol	Skin - Mild irritant	Man	-	48 hours 16	-
-				mg	
	Skin - Moderate irritant	Pig	-	100 %	-
	Skin - Moderate irritant	Rabbit	-	24 hours 100	-
				mg	
Titanium Dioxide	Skin - Mild irritant	Human	-	72 hours 300	-
				ug l	
1,3-Benzenedimethanamine	Eyes - Severe irritant	Rabbit	-	24 hours 50	-
				ug	
	Skin - Severe irritant	Rabbit	-	24 hours 750	-
				ug	

Sensitization

Not available.

Mutagenicity

Not available.

Carcinogenicity

Not available.

Classification

Date of issue/Date of revision: 4/19/2024B62L260SHERPLATE PW Epoxy (Part A)
Blue

: 1/23/2024

Section 11. Toxicological information

		U		
Ρ	roduct/ingredient name	OSHA	IARC	NTP
Ti	tanium Dioxide	-	2B	-

Reproductive toxicity

Not available.

Teratogenicity

Not available.

Specific target organ toxicity (single exposure)

Name	•••	Route of exposure	Target organs
	Category 3 Category 3		Respiratory tract irritation Narcotic effects

Specific target organ toxicity (repeated exposure)

Name		Route of exposure	Target organs
Phenylmethanol	Category 2	-	-

Aspiration hazard

Not available.

Information on the likely : Not available. routes of exposure

Potential acute health effectsEye contact: Causes serious eye damage.Inhalation: No known significant effects or critical hazards.Skin contact: Causes severe burns. May cause an allergic skin reaction.Ingestion: No known significant effects or critical hazards.

Symptoms related to the physical, chemical and toxicological characteristics

Eye contact	: Adverse symptoms may include the following: pain watering redness
Inhalation	: No specific data.
Skin contact	: Adverse symptoms may include the following: pain or irritation redness blistering may occur
Ingestion	: Adverse symptoms may include the following: stomach pains

Delayed and immediate effects and also chronic effects from short and long term exposure					
Short term exposure					
Potential immediate effects	: Not available.				
Potential delayed effects	: Not available.				
Long term exposure					

Date of issue/Date	of revision	: 4/19/2024	Date of previous issue	: 1/23/2024	Version	: 23.03	9/13
B62L260	SHERPLATE PW Epo Blue	xy (Part A)			SHW-85-	NA-GHS-US	

Section 11. Toxicological information

Potential immediate effects	:	Not available.
Potential delayed effects	÷	Not available.
Potential chronic health eff	<u>ec</u>	<u>ts</u>
Not available.		
General	:	May cause damage to organs through prolonged or repeated exposure. Once sensitized, a severe allergic reaction may occur when subsequently exposed to very low levels.
Carcinogenicity	:	Suspected of causing cancer. Risk of cancer depends on duration and level of exposure.
Mutagenicity	:	No known significant effects or critical hazards.
Teratogenicity	÷	No known significant effects or critical hazards.
Developmental effects	÷	No known significant effects or critical hazards.
Fertility effects	:	No known significant effects or critical hazards.

Numerical measures of toxicity

Acute toxicity estimates

Route	ATE value
Oral	3605.36 mg/kg
Dermal	7596.72 mg/kg
Inhalation (gases)	51461.37 ppm
Inhalation (vapors)	95.5 mg/l

Section 12. Ecological information

<u>Toxicity</u>			
Product/ingredient name	Result	Species	Exposure
Phenylmethanol Titanium Dioxide	Acute LC50 10 ppm Fresh water Acute LC50 >1000000 µg/l Marine water	Fish - Lepomis macrochirus Fish - Fundulus heteroclitus	96 hours 96 hours

Persistence and degradability

Product/ingredient name	Aquatic half-life	Photolysis	Biodegradability
Phenylmethanol	-	-	Readily

Bioaccumulative potential

Product/ingredient name	LogPow	BCF	Potential
1,3-Benzenedimethanamine	-	2.69	Low

Mobility in soil

Soil/water partition coefficient (Koc)

: Not available.

Other adverse effects

: No known significant effects or critical hazards.

Date of issue/Date of revision : 4/19	9/2024 Date of previous issue : 1/23	3/2024 Version : 23.03 1	0/13
B62L260 SHERPLATE PW Epoxy (Par Blue	rt A)	SHW-85-NA-GHS-US	

Section 13. Disposal considerations

Disposal methods

: The generation of waste should be avoided or minimized wherever possible. Disposal of this product, solutions and any by-products should at all times comply with the requirements of environmental protection and waste disposal legislation and any regional local authority requirements. Dispose of surplus and non-recyclable products via a licensed waste disposal contractor. Waste should not be disposed of untreated to the sewer unless fully compliant with the requirements of all authorities with jurisdiction. Waste packaging should be recycled. Incineration or landfill should only be considered when recycling is not feasible. This material and its container must be disposed of in a safe way. Care should be taken when handling emptied containers that have not been cleaned or rinsed out. Empty containers or liners may retain some product residues. Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers.

Section 14. Transport information

	DOT Classification	TDG Classification	Mexico Classification	ΙΑΤΑ	IMDG
UN number	UN3066	UN3066	UN3066	UN3066	UN3066
UN proper shipping name	PAINT	PAINT	PAINT	PAINT	PAINT. Marine pollutant (Styrenated- Phenolic Resin, Polyamide Additive)
Transport	8	8	8	8	8
hazard class(es)	CORIGEN		*		
Packing group	II	II	II	II	II
Environmental hazards	No.	No.	No.	Yes. The environmentally hazardous substance mark is not required.	Yes.
Additional information	-	Product classified as per the following sections of the Transportation of Dangerous Goods Regulations: 2.40-2.42 (Class 8).	-	The environmentally hazardous substance mark may appear if required by other transportation regulations.	The marine pollutant mark is not required when transported in sizes of ≤5 L or ≤5 kg. <u>Emergency</u> <u>schedules</u> F-A, S B
	ERG No.	ERG No.	ERG No.		
	153	153	153		

Section 14. Transport information

Special precautions for user	:	Multi-modal shipping descriptions are provided for informational purposes and do not consider container sizes. The presence of a shipping description for a particular mode of transport (sea, air, etc.), does not indicate that the product is packaged suitably for that mode of transport. All packaging must be reviewed for suitability prior to shipment, and compliance with the applicable regulations is the sole responsibility of the person offering the product for transport. People loading and unloading dangerous goods must be trained on all of the risks deriving from the substances and on all actions in case of emergency situations.
Transport in bulk according	:	Not available.

to IMO instruments

Proper shipping name

: Not available.

Section 15. Regulatory information

SARA 313

SARA 313 (40 CFR 372.45) supplier notification can be found on the Environmental Data Sheet, where applicable.

California Prop. 65

WARNING: This product contains chemicals known to the State of California to cause cancer and birth defects or other reproductive harm.

International regulations

Montreal Protocol

Not listed.


Stockholm Convention on Persistent Organic Pollutants

Not listed.

International lists	 Australia inventory (AIIC): Not determined. China inventory (IECSC): Not determined. Japan inventory (CSCL): Not determined. Japan inventory (ISHL): Not determined. Korea inventory (KECI): Not determined. New Zealand Inventory of Chemicals (NZIoC): Not determined. Philippines inventory (PICCS): Not determined. Taiwan Chemical Substances Inventory (TCSI): Not determined. Thailand inventory: Not determined. Turkey inventory: Not determined. Vietnam inventory: Not determined.
	Japan inventory (ISHL): Not determined. Korea inventory (KECI): Not determined. New Zealand Inventory of Chemicals (NZIoC): Not determined. Philippines inventory (PICCS): Not determined. Taiwan Chemical Substances Inventory (TCSI): Not determined Thailand inventory: Not determined.

Section 16. Other information

Hazardous Material Information System (U.S.A.)

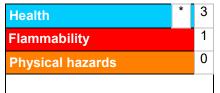

The customer is responsible for determining the PPE code for this material. For more information on HMIS® Personal Protective Equipment (PPE) codes, consult the HMIS® Implementation Manual.

Caution: HMIS® ratings are based on a 0-4 rating scale, with 0 representing minimal hazards or risks, and 4 representing significant hazards or risks. Although HMIS® ratings and the associated label are not required on SDSs or products leaving a facility under 29 CFR 1910.1200, the preparer may choose to provide them. HMIS® ratings are to be used with a fully implemented HMIS® program. HMIS® is a registered trademark and service mark of the American Coatings Association, Inc.

Procedure used to derive the classification

Date of issue/Date	of revision	: 4/19/2024	Date of previous issue	: 1/23/2024	Version	<mark>:</mark> 23.03	12/13
B62L260	SHERPLATE PW Epox Blue	vy (Part A)			SHW-85-	NA-GHS-US	

Section 16. Other information

	Justification				
SKIN CORROSION/IRRIT SERIOUS EYE DAMAGE/ SKIN SENSITIZATION - C CARCINOGENICITY - Cat SPECIFIC TARGET ORG	Calculation method Calculation method Calculation method Calculation method Calculation method				
History					
Date of printing	: 4/19/2024				
Date of issue/Date of revision	: 4/19/2024				
Date of previous issue	: 1/23/2024				
Version	: 23.03				
Key to abbreviations	: ATE = Acute Toxicity Estimate BCF = Bioconcentration Factor GHS = Globally Harmonized System of Classification and Labelling of Chemicals IATA = International Air Transport Association IBC = International Maritime Dangerous Goods LogPow = logarithm of the octanol/water partition coefficient MARPOL = International Convention for the Prevention of Pollution From Ships, 1973 as modified by the Protocol of 1978. ("Marpol" = marine pollution) N/A = Not available SGG = Segregation Group UN = United Nations				

Indicates information that has changed from previously issued version.

Notice to reader

It is recommended that each customer or recipient of this Safety Data Sheet (SDS) study it carefully and consult resources, as necessary or appropriate, to become aware of and understand the data contained in this SDS and any hazards associated with the product. This information is provided in good faith and believed to be accurate as of the effective date herein. However, no warranty, express or implied, is given. The information presented here applies only to the product as shipped. The addition of any material can change the composition, hazards and risks of the product. Products shall not be repackaged, modified, or tinted except as specifically instructed by the manufacturer, including but not limited to the incorporation of products not specified by the manufacturer, or the use or addition of products in proportions not specified by the manufacturer. Regulatory requirements are subject to change and may differ between various locations and jurisdictions. The customer/buyer/user is responsible to ensure that his activities comply with all country, federal, state, provincial or local laws. The conditions for use of the product are not under the control of the manufacturer; the customer/buyer/user is responsible to determine the conditions necessary for the safe use of this product. The customer/buyer/user should not use the product for any purpose other than the purpose shown in the applicable section of this SDS without first referring to the supplier and obtaining written handling instructions. Due to the proliferation of sources for information such as manufacturer-specific SDS, the manufacturer cannot be responsible for SDSs obtained from any other source.

Date of previous issue

: 1/23/2024