SAFETY DATA SHEET

RHS8-70001

Section 1. Identification

Product name	: POWDURA® RAL Series Superdurable TGIC Free Polyester Powder Coating RAL 7002 GL
Product code	: RHS8-70001
Other means of identification	: Not available.
Product type	: Powder.
Relevant identified uses of t	he substance or mixture and uses advised against
Paint or paint related material.	
Manufacturer	: THE SHERWIN-WILLIAMS COMPANY 101 W. Prospect Avenue Cleveland, OH 44115
National contact	: Sherwin-Williams Canada Inc. 180 Brunel Road Mississauga, Ontario L4Z 1T5 Canada
Emergency telephone number of the company	: US / Canada: (800) 424-9300 Mexico: SETIQ 800-00-214-00 / 55-5559-1588 Available 24 hours and 365 days a year
Product Information Telephone Number	: US / Canada: 866-722-9710 Mexico: Not Available
Transportation Emergency Telephone Number	: US / Canada: (800) 424-9300 Mexico: SETIQ 800-00-214-00 / 55-5559-1588 Available 24 hours and 365 days a year

Section 2. Hazards identification

Classification of the substance or mixture	: COMBUSTIBLE DUSTS SKIN SENSITIZATION - Category 1 CARCINOGENICITY - Category 1A
GHS label elements	
Hazard pictograms	
Signal word	: Danger
Hazard statements	 May cause an allergic skin reaction. May cause cancer. May form combustible dust concentrations in air.
Precautionary statements	
Prevention	: Obtain special instructions before use. Do not handle until all safety precautions have been read and understood. Wear protective gloves, protective clothing and eye or face protection. Avoid breathing dust or mist. Contaminated work clothing must not be allowed out of the workplace.

Date of issue/Date	of revision	: 4/19/2024	Date of previous issue	: 10/6/2023	Version	:18	1/15
RHS8-70001	POWDURA® RAL Series Sup RAL 7002 GL	perdurable TGIC Fre	ee Polyester Powder Coating		SHW-85-	NA-GHS-CA	

Section 2. Hazards identification

Response	: IF exposed or concerned: Get medical advice or attention. Wash contaminated clothing before reuse. IF ON SKIN: Wash with plenty of water. If skin irritation or rash occurs: Get medical advice or attention.
Storage	: Store locked up.
Disposal	 Dispose of contents and container in accordance with all local, regional, national and international regulations.
Supplemental label elements	Keep container tightly closed. Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking. Prevent dust accumulation. WARNING: This product contains chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. FOR INDUSTRIAL USE ONLY. Adequate ventilation required when sanding or abrading the dried film. If Adequate ventilation cannot be provided wear an approved particulate respirator (NIOSH approved). Follow respirator manufacturer's directions for respirator use. DELAYED EFFECTS FROM LONG TERM OVEREXPOSURE. Abrading or sanding of the dry film may release Crystalline Silica which has been shown to cause lung damage and cancer under long term exposure.
	Please refer to the SDS for additional information. Keep out of reach of children. Do not transfer contents to other containers for storage.
Hazards not otherwise classified	: None known.

Section 3. Composition/information on ingredients

Substance/mixture	1	Mixture
Other means of	1	Not available.
identification		

CAS number/other identifiers

Ingredient name	% by weight	CAS number
Barium Sulfate	14.72	7727-43-7
Titanium Dioxide	5.75	13463-67-7
Cobalt Chromite Green Spinel	2.98	68186-85-6
Iron Oxide	1.64	1309-37-1
Nickel Titanium Trioxide	0.17	12035-39-1
Crystalline Silica, respirable powder	0.12	14808-60-7

Any concentration shown as a range is to protect confidentiality or is due to batch variation.

There are no additional ingredients present which, within the current knowledge of the supplier and in the concentrations applicable, are classified and hence require reporting in this section.

Occupational exposure limits, if available, are listed in Section 8.

Section 4. First aid measures

Description of necessa	ry first aid measures
Eye contact	 Immediately flush eyes with plenty of water, occasionally lifting the upper and lower eyelids. Check for and remove any contact lenses. Continue to rinse for at least 10 minutes. Get medical attention.
Inhalation	: Remove victim to fresh air and keep at rest in a position comfortable for breathing. If not breathing, if breathing is irregular or if respiratory arrest occurs, provide artificial respiration or oxygen by trained personnel. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. Get medical attention. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband. In case of inhalation of decomposition products in a fire, symptoms may be delayed. The exposed person may need to be kept under medical surveillance for 48 hours.

Date of issue/Date	of revision	: 4/19/2024	Date of previous issue	: 10/6/2023	Version	:18	2/15
RHS8-70001	POWDURA® RAL Series Su RAL 7002 GL	perdurable TGIC Fre	ee Polyester Powder Coating		SHW-85-	NA-GHS-CA	

Section 4. First aid measures

Skin contact	: Wash with plenty of soap and water. Remove contaminated clothing and shoes. Wash contaminated clothing thoroughly with water before removing it, or wear gloves. Continue to rinse for at least 10 minutes. Get medical attention. In the event of any complaints or symptoms, avoid further exposure. Wash clothing before reuse. Clean shoes thoroughly before reuse.
Ingestion	: Wash out mouth with water. Remove dentures if any. If material has been swallowed and the exposed person is conscious, give small quantities of water to drink. Stop if the exposed person feels sick as vomiting may be dangerous. Do not induce vomiting unless directed to do so by medical personnel. If vomiting occurs, the head should be kept low so that vomit does not enter the lungs. Get medical attention. Never give anything by mouth to an unconscious person. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband.

Most important symptoms/effects, acute and delayed

Potential acute health effect	ts
Eye contact	: Exposure to airborne concentrations above statutory or recommended exposure limits may cause irritation of the eyes.
Inhalation	: Exposure to airborne concentrations above statutory or recommended exposure limits may cause irritation of the nose, throat and lungs.
Skin contact	: May cause an allergic skin reaction.
Ingestion	: No known significant effects or critical hazards.
Over-exposure signs/symp	<u>toms</u>
Eye contact	: Adverse symptoms may include the following: irritation redness
Inhalation	: Adverse symptoms may include the following: respiratory tract irritation coughing
Skin contact	: Adverse symptoms may include the following: irritation redness
Ingestion	: No specific data.
Indication of immediate med	lical attention and special treatment needed, if necessary
Notes to physician	: In case of inhalation of decomposition products in a fire, symptoms may be delayed. The exposed person may need to be kept under medical surveillance for 48 hours.
Specific treatments	: No specific treatment.
Protection of first-aiders	: No action shall be taken involving any personal risk or without suitable training. If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. Wash contaminated clothing thoroughly with water before removing it, or wear gloves.

See toxicological information (Section 11)

Section 5. Fire-fighting measures

Extinguishing media	
Suitable extinguishing media	: Use dry chemical powder.
Unsuitable extinguishing media	: Avoid high pressure media which could cause the formation of a potentially explosible dust-air mixture.
Specific hazards arising from the chemical	: May form explosible dust-air mixture if dispersed.
Hazardous thermal decomposition products	: Decomposition products may include the following materials: carbon dioxide carbon monoxide nitrogen oxides sulfur oxides metal oxide/oxides
Special protective actions for fire-fighters	: Promptly isolate the scene by removing all persons from the vicinity of the incident if there is a fire. No action shall be taken involving any personal risk or without suitable training. Move containers from fire area if this can be done without risk. Use water spray to keep fire-exposed containers cool.
Special protective equipment for fire-fighters	: Fire-fighters should wear appropriate protective equipment and self-contained breathing apparatus (SCBA) with a full face-piece operated in positive pressure mode.

Section 6. Accidental release measures

Personal precautions, protect	tiv	e equipment and emergency procedures
For non-emergency personnel	:	No action shall be taken involving any personal risk or without suitable training. Evacuate surrounding areas. Keep unnecessary and unprotected personnel from entering. Do not touch or walk through spilled material. Shut off all ignition sources. No flares, smoking or flames in hazard area. Avoid breathing dust. Provide adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Put on appropriate personal protective equipment.
For emergency responders	:	If specialized clothing is required to deal with the spillage, take note of any information in Section 8 on suitable and unsuitable materials. See also the information in "For non-emergency personnel".
Environmental precautions	:	Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers. Inform the relevant authorities if the product has caused environmental pollution (sewers, waterways, soil or air).
Methods and materials for co	onta	ainment and cleaning up
Small spill	:	Move containers from spill area. Use spark-proof tools and explosion-proof equipment. Avoid dust generation. Do not dry sweep. Vacuum dust with equipment fitted with a HEPA filter and place in a closed, labeled waste container. Place spilled material in a designated, labeled waste container. Dispose of via a licensed waste disposal contractor.
Large spill	:	Move containers from spill area. Use spark-proof tools and explosion-proof equipment. Approach release from upwind. Prevent entry into sewers, water courses, basements or confined areas. Avoid dust generation. Do not dry sweep. Vacuum dust with equipment fitted with a HEPA filter and place in a closed, labeled waste container. Avoid creating dusty conditions and prevent wind dispersal. Dispose of via a licensed waste disposal contractor. Note: see Section 1 for emergency contact information and Section 13 for waste disposal.

Section 7. Handling and storage

	U	
Precautions for safe handling		
Protective measures	on appropriate personal protective equipmery of skin sensitization problems should no product is used. Avoid exposure - obtain se lle until all safety precautions have been re- in skin or clothing. Do not ingest. Avoid bro- n handling and avoid all possible sources of mulation. Use only with adequate ventilate lation is inadequate. Keep in the original of e from a compatible material, kept tightly of poment and lighting should be protected to a fing into contact with hot surfaces, sparks of autionary measures against electrostatic do pate static electricity during transfer by gro- poment before transferring material. Empty be hazardous. Do not reuse container.	be the employed in any process in which special instructions before use. Do not ead and understood. Do not get in eyes eathing dust. Avoid the creation of dust of ignition (spark or flame). Prevent dust ion. Wear appropriate respirator when container or an approved alternative closed when not in use. Electrical appropriate standards to prevent dust or other ignition sources. Take lischarges. To avoid fire or explosion, bunding and bonding containers and
Advice on general occupational hygiene	ng, drinking and smoking should be prohib lled, stored and processed. Workers shou ing and smoking. Remove contaminated ring eating areas. See also Section 8 for a sures.	uld wash hands and face before eating, clothing and protective equipment before
Conditions for safe storage, including any incompatibilities	e in accordance with local regulations. Sto e in original container protected from direc , away from incompatible materials (see S ed up. Eliminate all ignition sources. Sepa ainer tightly closed and sealed until ready t red must be carefully resealed and kept up beled containers. Use appropriate contain amination. See Section 10 for incompatible	t sunlight in a dry, cool and well-ventilated ection 10) and food and drink. Store arate from oxidizing materials. Keep for use. Containers that have been oright to prevent leakage. Do not store in ment to avoid environmental

Section 8. Exposure controls/personal protection

Control parameters

Occupational exposure limits (OSHA United States)

Ingredient name	CAS #	Exposure limits			
Barium Sulfate	7727-43-7	ACGIH TLV (United States, 1/2023). TWA: 5 mg/m ³ 8 hours. Form: Inhalable fraction NIOSH REL (United States, 10/2020). TWA: 5 mg/m ³ 10 hours. Form: Respirable fraction TWA: 10 mg/m ³ 10 hours. Form: Total OSHA PEL (United States, 5/2018). TWA: 5 mg/m ³ 8 hours. Form: Respirable fraction TWA: 15 mg/m ³ 8 hours. Form: Total dust			
Titanium Dioxide	13463-67-7	OSHA PEL (United States, 5/2018). TWA: 15 mg/m ³ 8 hours. Form: Total dust ACGIH TLV (United States, 1/2023). TWA: 2.5 mg/m ³ 8 hours. Form: respirable fraction, finescale particles			
Cobalt Chromite Green Spinel	68186-85-6	ACGIH TLV (United States, 1/2023). [cobalt and inorganic compounds as Co] Skin sensitizer. Inhalation sensitizer. TWA: 0.02 mg/m ³ , (as Co) 8 hours.			
ate of issue/Date of revision : 4/19/2024 D	ate of previous issue	: 10/6/2023 Version : 18 5/15			
HS8-70001 POWDURA® RAL Series Superdurable TGIC Free RAL 7002 GL	Polyester Powder Coating	SHW-85-NA-GHS-CA			

•	•	
Iron Oxide	1309-37-1	ACGIH TLV (United States, 1/2023). [Nickel, insoluble inorganic compounds as Ni] TWA: 0.2 mg/m ³ , (as Ni) 8 hours. Form: Inhalable fraction OSHA PEL (United States, 5/2018). [Nickel, metal and insoluble compounds (as Ni)] TWA: 1 mg/m ³ , (as Ni) 8 hours. NIOSH REL (United States, 10/2020). TWA: 5 mg/m ³ , (as Fe) 10 hours. Form: Dust and fumes ACGIH TLV (United States, 1/2023). TWA: 5 mg/m ³ 8 hours. Form: Respirable fraction
		OSHA PEL (United States, 5/2018). TWA: 5 mg/m ³ 8 hours. Form: Respirable fraction TWA: 15 mg/m ³ 8 hours. Form: Total dust
Nickel Titanium Trioxide	12035-39-1	OSHA PEL (United States, 5/2018). [Nickel, metal and insoluble compounds (as Ni)] TWA: 1 mg/m ³ , (as Ni) 8 hours. ACGIH TLV (United States, 1/2023). [Nickel, insoluble inorganic compounds as Ni] TWA: 0.2 mg/m ³ , (as Ni) 8 hours. Form: Inhalable fraction
Crystalline Silica, respirable powder	14808-60-7	 OSHA PEL Z3 (United States, 6/2016). TWA: 250 mppcf / (%SiO2+5) 8 hours. Form: Respirable TWA: 10 mg/m³ / (%SiO2+2) 8 hours. Form: Respirable OSHA PEL (United States, 5/2018). [Silica, crystalline] TWA: 50 µg/m³ 8 hours. Form: Respirable dust ACGIH TLV (United States, 1/2023). [Silica, crystalline] TWA: 0.025 mg/m³ 8 hours. Form: Respirable fraction NIOSH REL (United States, 10/2020). [SILICA, CRYSTALLINE (AS RESPIRABLE DUST)] TWA: 0.05 mg/m³ 10 hours. Form: respirable dust

Occupational exposure limits (Canada)

Ingredient name CAS #			CAS #	Exposure limi	ts	
Nickel Tita	nium Trioxide		12035-39-1	7/2013). [Nicke compounds as specified, inha STEL: 0.6 mg/ minutes. Form: TWA: 0.2 mg/ Form: Inhalable CA Ontario Pro [Nickel (Insolu	/m³, (measured as Ni) 15 Inhalable fraction m³, (measured as Ni) 8 h	ours. 9).
ate of issue/Da	ate of revision	: 4/19/2024	Date of previous issue	: 10/6/2023	Version :18	6/15
HS8-70001 POWDURA® RAL Series Superdurable TGIC Free RAL 7002 GL		Free Polyester Powder Coating		SHW-85-NA-GHS-C/	4	

•		
Quartz	14808-60-7	Inhalable particulate matter. CA Alberta Provincial (Canada, 6/2018). [Nickel Insoluble compounds as Ni] 8 hrs OEL: 0.2 mg/m³, (as Ni) 8 hours. CA British Columbia Provincial (Canada, 6/2022). [Nickel - Insoluble inorganic compounds as Ni] TWA: 0.05 mg/m³, (as Ni) 8 hours. CA Quebec Provincial (Canada, 6/2022). [nickel and inorganic compounds - insoluble compounds] TWAEV: 0.2 mg/m³, (as Ni) 8 hours. Form: inhalable dust CA British Columbia Provincial (Canada, 6/2022). [Silica, Crystalline - alpha quartz and Cristobalite Respirable] TWA: 0.025 mg/m³ 8 hours. Form: Respirable CA Quebec Provincial (Canada, 6/2022). [Silica Crystalline -Quartz] TWAEV: 0.1 mg/m³ 8 hours. Form: Respirable dust. CA Alberta Provincial (Canada, 6/2018). 8 hrs OEL: 0.025 mg/m³ 8 hours. Form: Respirable particulate CA Ontario Provincial (Canada, 6/2019). [Silica, Crystalline (Quartz/Tripoli)] TWA: 0.1 mg/m³ 8 hours. Form: Respirable particulate CA Ontario Provincial (Canada, 6/2019). [Silica, Crystalline (Quartz/Tripoli)] TWA: 0.1 mg/m³ 8 hours. Form: Respirable particulate matter. CA Saskatchewan Provincial (Canada, 7/2013). TWA: 0.05 mg/m³ 8 hours. Form: respirable fraction
Occupational exposure limits (Mexico)		

Ingredient name	CAS #	Exposure limits
Nickel Titanium Trioxide		NOM-010-STPS-2014 (Mexico, 4/2016). [Nickel inorganic compounds, insoluble] TWA: 0.2 mg/m ³ , (as Ni) 8 hours. Form: Inhalable fraction

Biological exposure indices (United States)

Ingredient	Ingredient name			Exposure indices			
Cobalt Chro	omite Green Spin	el		carbide - cobalt of shift at end of	compounds inc ot combined with [in urine]. Samp f workweek. itative: Biologica dered for this co view; however, a termined due to h tungsten carbi	cluding can tungster ling time: al monitorio mpound a specific insufficier de - coba	obalt end ing BEI® nt It [in
Date of issue/D	ate of revision	: 4/19/2024	Date of previous issue	: 10/6/2023	Version	: 18	7/15
RHS8-70001	POWDURA® RAL Se RAL 7002 GL	ries Superdurable TGIC F	ree Polyester Powder Coating		SHW-85-N	A-GHS-CA	

	ACGIH BEI (United States, 1/2023) [nickel and inorganic compounds] BEI: 30 μg/l, nickel [in urine after exposure to soluble compounds]. Sampling time: post-shift at end of workweek. BEI: 5 μg/l, nickel [in urine after exposure to elemental nickel and poorly soluble compounds]. Sampling time: post-shift at end of workweek.
Nickel Titanium Trioxide	ACGIH BEI (United States, 1/2023) [nickel and inorganic compounds] BEI: 30 µg/l, nickel [in urine after exposure to soluble compounds]. Sampling time: post-shift at end of workweek. BEI: 5 µg/l, nickel [in urine after exposure to elemental nickel and poorly soluble compounds]. Sampling time: post-shift at end of workweek.

Biological exposure indices (Canada)

No exposure indices known.

Biological exposure indices (Mexico)

No exposure indices known.

Appropriate engineering controls Environmental exposure controls		Use only with adequate ventilation. If user operations generate dust, fumes, gas, vapor or mist, use process enclosures, local exhaust ventilation or other engineering controls to keep worker exposure to airborne contaminants below any recommended or statutory limits. The engineering controls also need to keep gas, vapor or dust concentrations below any lower explosive limits. Use explosion-proof ventilation equipment. Emissions from ventilation or work process equipment should be checked to ensure they comply with the requirements of environmental protection legislation. In some cases, fume scrubbers, filters or engineering modifications to the process equipment
		will be necessary to reduce emissions to acceptable levels.
Individual protection measured	res	
Hygiene measures	:	Wash hands, forearms and face thoroughly after handling chemical products, before eating, smoking and using the lavatory and at the end of the working period. Appropriate techniques should be used to remove potentially contaminated clothing. Contaminated work clothing should not be allowed out of the workplace. Wash contaminated clothing before reusing. Ensure that eyewash stations and safety showers are close to the workstation location.
Eye/face protection	:	Safety eyewear complying with an approved standard should be used when a risk assessment indicates this is necessary to avoid exposure to liquid splashes, mists, gases or dusts. If contact is possible, the following protection should be worn, unless the assessment indicates a higher degree of protection: safety glasses with side- shields. If operating conditions cause high dust concentrations to be produced, use dust goggles.
Skin protection		

Hand protection	: Chemical-resistant, impervious gloves complying with an approved standard should be worn at all times when handling chemical products if a risk assessment indicates this is necessary. Considering the parameters specified by the glove manufacturer, check during use that the gloves are still retaining their protective properties. It should be noted that the time to breakthrough for any glove material may be different for different glove manufacturers. In the case of mixtures, consisting of several substances, the protection time of the gloves cannot be accurately estimated.
Body protection	: Personal protective equipment for the body should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product.
Other skin protection	: Appropriate footwear and any additional skin protection measures should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product.
Respiratory protection	: Based on the hazard and potential for exposure, select a respirator that meets the appropriate standard or certification. Respirators must be used according to a respiratory protection program to ensure proper fitting, training, and other important aspects of use.

Section 9. Physical and chemical properties

The conditions of measurement of all properties are at standard temperature and pressure unless otherwise indicated.

Appearance

Physical state	: Sol	lid.		
Color	: Bei	ige.		
Odor	: No	t available.		
Odor threshold	: No	t available.		
рН	: No	t applicable.		
Melting point/freezing point	: No	t available.		
Boiling point, initial boiling point, and boiling range	: Not	t available.		
Flash point	: Clo	osed cup: Not applicable.		
Evaporation rate	: No	t available.		
Flammability	: No	t available.		
Lower and upper explosion limit/flammability limit	: Not	t applicable.		
Vapor pressure	: Not available.			
Relative vapor density	: No	t applicable.		
Relative density	: 1.5	; ;		
Solubility(ies)	:			
Media		Result		
cold water		Not soluble		
Partition coefficient: n- octanol/water	: Not	t applicable.		
Auto-ignition temperature	: Not	t applicable.		
Decomposition temperature	: Not	t available.		
Viscosity	: Kir	nematic (40°C (104°F)): >20.5 mm²/s (>20.5 cSt)		
Molecular weight	: No	ot applicable.		
Heat of combustion	: 0.1	l43 kJ/g		

Date of issue/Date	of revision	: 4/19/2024	Date of previous issue	: 10/6/2023	Version	:18	9/15
RHS8-70001	POWDURA® RAL Series Sup RAL 7002 GL	perdurable TGIC Fre	e Polyester Powder Coating		SHW-85-	NA-GHS-CA	

Section 10. Stability and reactivity

Reactivity	: No specific test data related to reactivity available for this product or its ingredients.
Chemical stability	: The product is stable.
Possibility of hazardous reactions	: Under normal conditions of storage and use, hazardous reactions will not occur.
Conditions to avoid	: Avoid the creation of dust when handling and avoid all possible sources of ignition (spark or flame). Take precautionary measures against electrostatic discharges. To avoid fire or explosion, dissipate static electricity during transfer by grounding and bonding containers and equipment before transferring material. Prevent dust accumulation.
Incompatible materials	: Reactive or incompatible with the following materials: oxidizing materials
Hazardous decomposition products	: Under normal conditions of storage and use, hazardous decomposition products should not be produced.

Section 11. Toxicological information

Information on toxicological effects

Acute toxicity

Not available.

Irritation/Corrosion

Product/ingredient name	Result	Species	Score	Exposure	Observation
Titanium Dioxide	Skin - Mild irritant	Human	-	72 hours 300	-
				ug l	

Sensitization

Not available.

Mutagenicity

Not available.

Carcinogenicity

Not available.

Classification

Product/ingredient name	OSHA	IARC	NTP
Titanium Dioxide	-	2B	-
Cobalt Chromite Green Spinel	-	1	Known to be a human carcinogen.
Iron Oxide	-	3	-
Nickel Titanium Trioxide	-	1	Known to be a human carcinogen.
Crystalline Silica, respirable powder	+	1	Known to be a human carcinogen.

Reproductive toxicity

Not available.

Teratogenicity

Not available.

Date of issue/Date	of revision	: 4/19/2024	Date of previous issue	: 10/6/2023	Version : 18	10/15
RHS8-70001	POWDURA® RAL Series S RAL 7002 GL	uperdurable TGIC F	ree Polyester Powder Coating		SHW-85-NA-GH	S-CA

Section 11. Toxicological information

Specific target organ toxicity (single exposure)

Not available.

Specific target organ toxicity (repeated exposure)

Name		Route of exposure	Target organs
Nickel Titanium Trioxide	Category 1	-	-
Crystalline Silica, respirable powder	Category 1	inhalation	

Aspiration hazard

Not available.

Information on the likely routes of exposure	: Not available.
Potential acute health effe	<u>cts</u>
Eye contact	: Exposure to airborne concentrations above statutory or recommended exposure limits may cause irritation of the eyes.
Inhalation	: Exposure to airborne concentrations above statutory or recommended exposure limits may cause irritation of the nose, throat and lungs.
Skin contact	: May cause an allergic skin reaction.
Ingestion	: No known significant effects or critical hazards.
Symptoms related to the p	hysical, chemical and toxicological characteristics
Eye contact	: Adverse symptoms may include the following: irritation redness
Inhalation	: Adverse symptoms may include the following: respiratory tract irritation coughing
Skin contact	: Adverse symptoms may include the following: irritation redness
Ingestion	: No specific data.
Delaved and immediate ef	ects and also chronic effects from short and long term exposure
Short term exposure	
Potential immediate effects	: Not available.
Potential delayed effects	: Not available.
Long term exposure	
Potential immediate effects	: Not available.
Potential delayed effects	: Not available.
Potential chronic health ef	<u>fects</u>
Not available.	
General	: Repeated or prolonged inhalation of dust may lead to chronic respiratory irritation. Once sensitized, a severe allergic reaction may occur when subsequently exposed to very low levels.
Carcinogenicity	: May cause cancer. Risk of cancer depends on duration and level of exposure.
Mutagenicity	: No known significant effects or critical hazards.
Date of issue/Date of revision	: 4/19/2024 Date of previous issue : 10/6/2023 Version : 18 11/15
RHS8-70001 POWDURA® RAL S RAL 7002 GL	Series Superdurable TGIC Free Polyester Powder Coating SHW-85-NA-GHS-CA

Section 11. Toxicological information

Teratogenicity Developmental effects Fertility effects

- : No known significant effects or critical hazards.
- : No known significant effects or critical hazards.
- : No known significant effects or critical hazards.

Numerical measures of toxicity Acute toxicity estimates Not available.

Section 12. Ecological information

Toxicity

Product/ingredient name	Result	Species	Exposure
	5	Crustaceans - <i>Cypris subglobosa</i> Daphnia - <i>Daphnia magna</i>	48 hours 48 hours
Titanium Dioxide	Acute LC50 >1000000 μg/l Marine water	Fish - Fundulus heteroclitus	96 hours

Persistence and degradability

Not available.

Bioaccumulative potential

Not available.

<u>Mobility in soil</u>

Soil/water partition : Not available. coefficient (K_{oc})

Other adverse effects : No known significant effects or critical hazards.

Section 13. Disposal considerations

Disposal methods

: The generation of waste should be avoided or minimized wherever possible. Disposal of this product, solutions and any by-products should at all times comply with the requirements of environmental protection and waste disposal legislation and any regional local authority requirements. Dispose of surplus and non-recyclable products via a licensed waste disposal contractor. Waste should not be disposed of untreated to the sewer unless fully compliant with the requirements of all authorities with jurisdiction. Waste packaging should be recycled. Incineration or landfill should only be considered when recycling is not feasible. This material and its container must be disposed of in a safe way. Care should be taken when handling emptied containers that have not been cleaned or rinsed out. Empty containers or liners may retain some product residues. Avoid dispersal of spilled material and runoff and contact with soil, waterways, drains and sewers.

: 10/6/2023

Section 14. Transport information

	DOT Classification	TDG Classification	Mexico Classification	ΙΑΤΑ	IMDG
UN number	Not regulated.	Not regulated.	Not regulated.	Not regulated.	Not regulated.
UN proper shipping name	-	-	-	-	-
Transport hazard class(es)	-	-	-	-	-
Packing group	-	-	-	-	-
Environmental hazards	No.	No.	No.	No.	No.
Additional information	-	-	-	-	-
Special precautions Fransport in bulk ac o IMO instruments	conside mode o suitably to shipn of the p dangero and on	odal shipping descri r container sizes. Th f transport (sea, air, for that mode of trainent, and complianc erson offering the pr bus goods must be to all actions in case of able.	ne presence of a shi etc.), does not indic nsport. All packaging e with the applicable oduct for transport. rained on all of the r	pping description fo ate that the product g must be reviewed regulations is the s People loading and isks deriving from th	r a particular is packaged for suitability prior sole responsibility unloading
	Proper s	hipping name	: Not available.		

Section 15. Regulatory information


Internationa	I regulations					
<u>Montreal P</u>	<u>rotocol</u>					
Not listed.						
Stockholm	Convention on P	ersistent Org	ganic Pollutants			
Not listed.			-			
Internationa	l lists	: Australia	a inventory (AIIC): Not c	letermined.		
		China in	ventory (IECSC): Not de	etermined.		
		Japan ir	ventory (CSCL): Not de	etermined.		
		Japan ir	ventory (ISHL): Not det	ermined.		
		Korea in	ventory (KECI): Not det	ermined.		
		New Zea	aland Inventory of Cher	nicals (NZIoC): No	t determined.	
		Philippiı	nes inventory (PICCS):	Not determined.		
		Taiwan	Chemical Substances I	nventory (TCSI): N	lot determined.	
		Thailand	l inventory : Not determi	ned.		
		Turkey i	nventory: Not determine	ed.		
Date of issue/Dat	te of revision	: 4/19/2024	Date of previous issue	: 10/6/2023	Version :1	8 13/15
RHS8-70001	POWDURA® RAL Series RAL 7002 GL	Superdurable TGIC I	Free Polyester Powder Coating		SHW-85-NA	GHS-CA

Section 15. Regulatory information

Vietnam inventory: Not determined.

Section 16. Other information



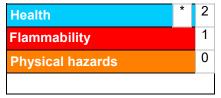

The customer is responsible for determining the PPE code for this material. For more information on HMIS® Personal Protective Equipment (PPE) codes, consult the HMIS® Implementation Manual.

Caution: HMIS® ratings are based on a 0-4 rating scale, with 0 representing minimal hazards or risks, and 4 representing significant hazards or risks. Although HMIS® ratings and the associated label are not required on SDSs or products leaving a facility under 29 CFR 1910.1200, the preparer may choose to provide them. HMIS® ratings are to be used with a fully implemented HMIS® program. HMIS® is a registered trademark and service mark of the American Coatings Association, Inc.

Procedure used to derive the classification

Classification	Justification
COMBUSTIBLE DUSTS SKIN SENSITIZATION - Category 1 CARCINOGENICITY - Category 1A	On basis of test data Calculation method Calculation method
History	

<u>Instory</u>	
Date of printing	: 4/19/2024
Date of issue/Date of revision	: 4/19/2024
Date of previous issue	: 10/6/2023
Version	: 18
Key to abbreviations	: ATE = Acute Toxicity Estimate BCF = Bioconcentration Factor GHS = Globally Harmonized System of Classification and Labelling of Chemicals IATA = International Air Transport Association IBC = Internediate Bulk Container IMDG = International Maritime Dangerous Goods LogPow = logarithm of the octanol/water partition coefficient MARPOL = International Convention for the Prevention of Pollution From Ships, 1973 as modified by the Protocol of 1978. ("Marpol" = marine pollution) N/A = Not available SGG = Segregation Group UN = United Nations
	lh at h an all an unail fue un una star sa h star al second second an

Indicates information that has changed from previously issued version.

Notice to reader

It is recommended that each customer or recipient of this Safety Data Sheet (SDS) study it carefully and consult resources, as necessary or appropriate, to become aware of and understand the data contained in this SDS and any hazards associated with the product. This information is provided in good faith and believed to be accurate as of the effective date herein. However, no warranty, express or implied, is given. The information presented here applies only to the product as shipped. The addition of any material can change the composition, hazards and risks of the product. Products shall not be repackaged, modified, or tinted except as specifically instructed by the manufacturer, including but not limited to the incorporation of products not specified by the manufacturer, or the use or addition of products in proportions not specified by the manufacturer. Regulatory requirements are subject to change and may differ between various locations and jurisdictions. The customer/buyer/user is responsible to ensure that his activities comply with all country, federal, state, provincial or local laws. The conditions for use of the product are not under the control of the manufacturer; the customer/buyer/user is

Date of issue/Date	of revision	: 4/19/2024	Date of previous issue	: 10/6/2023	Version	:18	14/15
RHS8-70001	POWDURA® RAL Series Sup RAL 7002 GL	erdurable TGIC Fre	ee Polyester Powder Coating		SHW-85-	NA-GHS-CA	

Section 16. Other information

responsible to determine the conditions necessary for the safe use of this product. The customer/buyer/user should not use the product for any purpose other than the purpose shown in the applicable section of this SDS without first referring to the supplier and obtaining written handling instructions. Due to the proliferation of sources for information such as manufacturer-specific SDS, the manufacturer cannot be responsible for SDSs obtained from any other source.